SCUBAPRO MK 18 First Stage Trouble Shooting Guide


| Symptom | Correction | | Tools Needed | |
|-------------------------------------|--------------------------------|--|-------------------|--|
| Audible leak from ports or plugs | Tighten hoses, ports and plugs | Replace damaged o'rings Seat all o'rings properly | Adjustable wrench | |
| | | | | |

| High IP (3000 psi supply) | Adjust IP down (counterclockwise) | 6 mm hex wrench | Pneumatic adjusting tool |
|--|-----------------------------------|--------------------|--------------------------------|
| 225-145 psi 8.5 - 10 bar 100 - 250 100 - 250 100 - 250 100 - 50 - 100 100 - 50 - 50 - 50 100 - | El25-145 psi 8,5 - 10 bar | | |

| Low IP (3000 psi supply) | Adjust IP up (clockwise) | 6 mm hex wrench | Pneumatic adjusting tool |
|---|--------------------------|--------------------|--------------------------------|
| S S S C C C C U U U B B B A A A F R R 0 O 0 | | | |

SCUBAPRO MK 18 First Stage Trouble Shooting Guide

| Symptom | Correction | | Tools Needed | |
|---------------------------|---|---|---------------------|--|
| Audible leak from end cap | Inspect diaphragm and retaining washer. | Tighten end cap while holding unit with field | | |
| | Replace if needed. | handle | | |

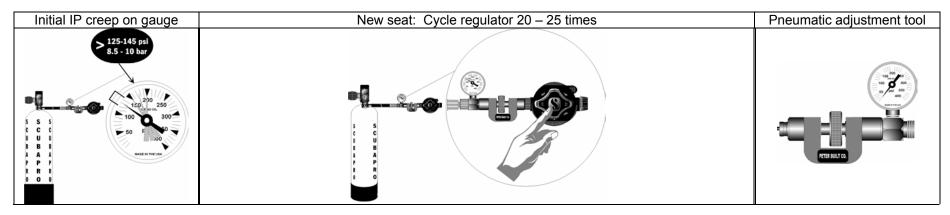

| Continuous IP creep on gauge | Replace seat or o'rings | Replace body | Various |
|---|-------------------------|--------------|---------|
| 220,145 pt 8.5 - 10 bar 50 - 10 200 50 - | | | |